

Installation Instructions: 755/775LR Deadbreak Elbow Connectors

CONTENTS: Elbow, Cable Adapter, Compression Lug, Insulating Plug, Lubricant, Stud Prepack, Installation Instructions, Crimp chart.

The 755/775LR connectors are designed to: 1) provide fully shielded, fully submersible deadfront cable connections to high voltage apparatus and 2) provide a means to splice and tap 600-ampere (755LR) or 900-ampere (775LR) systems. The connectors are rated for use on 35kV class systems.

DANGER

All apparatus must be de-energized during installation or removal of part(s).

Do not touch or move energized products in the work area.

These instructions do not attempt to provide for every possible contingency.

Failure to follow these instructions will result in damage to the product and serious or fatal injury.

This product should be installed only by competent personnel trained in good safety practices involving high voltage electrical equipment. These instructions are not intended as a substitute for adequate training or experience in such safety practices.

All apparatus must be installed and operated in accordance with individual user, local, and national work rules.

For loadbreak products follow operating instructions. All deadbreak connectors must be de-energized before operating. All 200A deadbreak connectors must be mechanically secured with bails when connected.

If this product is supplied with a protective shipping cover(s), remove this shipping cover(s) and replace with the appropriate HV insulated cap(s) or connector(s) before submerging or energizing the circuit.

Inspect parts for damage, rating and compatibility with mating parts.

Excess distortion of the assembled product may result in its failure.

FOR MORE INFORMATION ON PARTS, INSTALLATION RATINGS AND COMPATIBILITY, CALL THE NEAREST ELASTIMOLD[®] OFFICE.

Limited Warranty:

1. T&B warrants that its products will be free from defects in materials or workmanship for a period of two (2) years, except for tools which are warranted separately (see warranty accompanying those products). Fisher Pierce[®] products and Elastimold[®] Reclosers are warranted for three years; and Joslyn t VBT and VBU capacitor switches are warranted for four years or 40,000 operations whichever occurs first. Upon prompt notification of a warranted defect, T&B will, at its option, repair or replace the defective product.
2. In no event shall T&B be liable for any consequential, indirect or special damages, nor will T&B be liable for transportation, labor, or other charges arising out of the removal or reinstallation of its products. Liability for breach of warranty is limited to the cost of repair or replacement of the warranted product only.
3. Misuse, misapplication or modification of T&B products immediately voids all warranties.

THE WARRANTIES AND REMEDIES CONTAINED HEREIN ARE EXCLUSIVE AND ARE IN LIEU OF ALL OTHER WARRANTIES AND REMEDIES, INCLUDING BUT NOT LIMITED TO ANY IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE, WHICH ARE SPECIFICALLY DISCLAIMED.


IMPORTANT

1. Check contents of package to ensure they are complete and undamaged.
2. Check all components to ensure proper fit with cable and/or mating products.
3. Read entire installation instructions before starting.
4. Have all required tools at hand and maintain cleanliness throughout the procedure.

GENERAL INSTRUCTIONS

STEP 1

Position the cable so it is located in the final assembled position with enough slack to provide adequate clearance for removing the elbows. For concentric neutral cable, unwind the concentric neutral wires. Cut the cable 1-3/4" (45mm) from center line of the mating product.

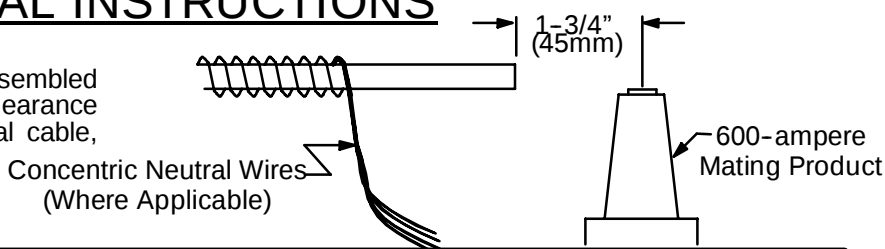

STEP 2

Clean the outer jacket of the cable a distance of 24" (610mm).

Thomas & Betts

A Member of the ABB Group

STEP 3 CABLE PREPARATION **NOTE:** Follow the STEPS A, B or C that apply to the cable being prepared.

A. If a 20MA or 21MA grounding device or 600ECS Jacket Cable Seal is being used, refer to the Installation Instructions supplied with those products for removal of cable outer jacket, shield connection and grounding.

B. UNISHIELD* AND LEAD SHEATH CABLE


For UNISHIELD* or LEAD SHEATH cable a 10TL cable shield adapter is required. Refer to the Installation Instructions supplied with the 10TL cable shield adapter for cable preparation.

**Unishield is a registered Trade Mark of ANACONDA WIRE and CABLE COMPANY.*


C. JACKETED AND NON-JACKETED CABLE

Remove the outer jacket (where applicable) and prepare cable as shown.


1. NON-JACKETED CONCENTRIC NEUTRAL WIRES

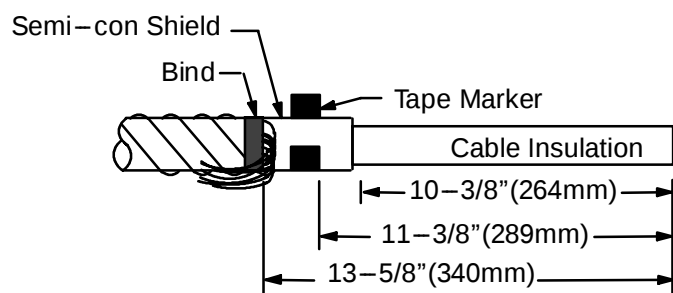


2. JACKETED SHIELD WIRES

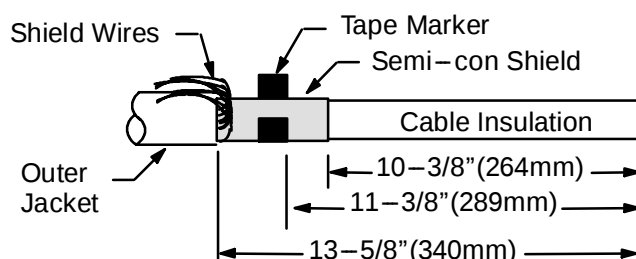


3. JACKETED FLAT METALLIC TAPE SHIELD

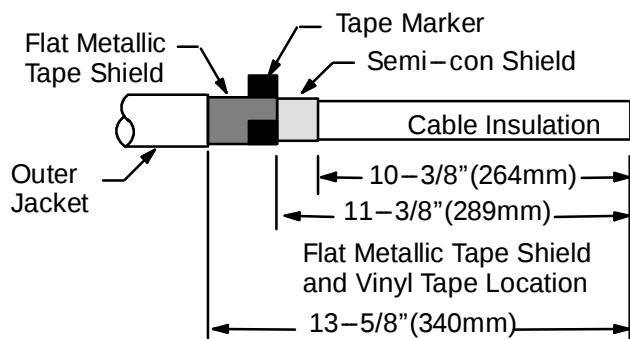

4. JACKETED FABRIC TAPE SHIELD

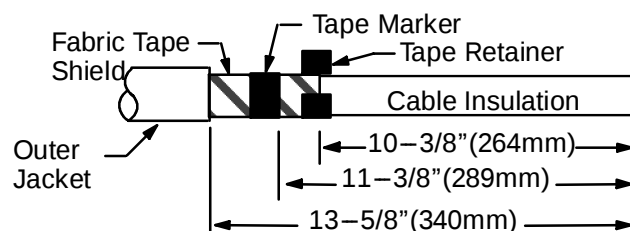


5. JACKETED LONGITUDINALLY CORRUGATED SHIELD

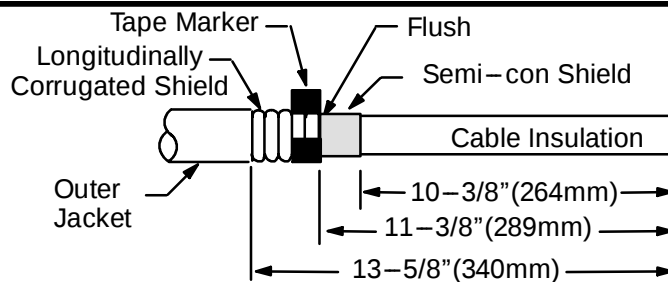


STEP 4 CABLE ADAPTER

Bevel the end of the cable insulation at a 45 degree angle, approximately 1/4" (6mm) back. Thoroughly clean, then lubricate cable insulation always working toward semi-con shield. Install cable adapter, small end first, until it is flush with the edge of the tape marker.

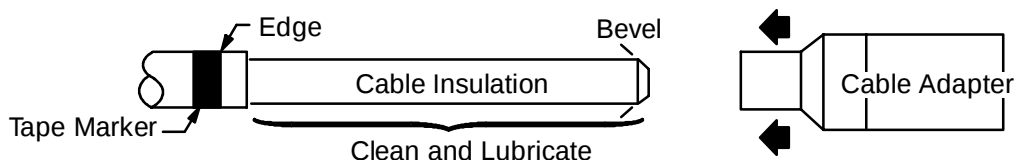

STEP 5 CONDUCTOR

Remove the protruding cable insulation by cutting it even with the end of the cable adapter. Do not cut or nick the cable adapter or the conductor. The length of exposed conductor should be between 4-3/8" to 4-3/4" (111mm-121mm). Otherwise redo assembly.

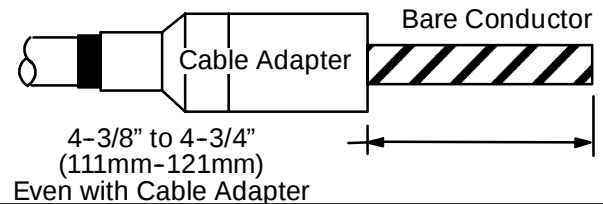


STEP 6 COMPRESSION LUG

Copper Conductor: Fully insert conductor into compression Lug.


Aluminum Conductor: Wire brush conductor and immediately fully insert conductor into compression lug.

Measure the "Check Dimension" before crimping. This dimension should be less than 7" (178mm). Otherwise redo assembly. Crimp the compression lug following the crimping instructions supplied with the lug. Wipe all excess inhibitor from compression lug and cable adapter surface after crimping. The distance from the end of the compression lug to the cable adapter after crimping should be between 6-7/8" to 7-5/8" (175mm-194mm). Otherwise redo assembly.

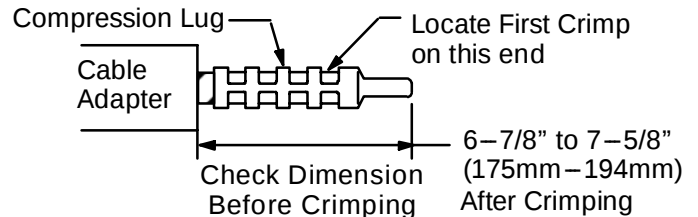

STEP 7 ELBOW


Lubricate cable adapter and inside of elbow cable entrance. Install elbow onto cable adapter until the elbow can not advance further. Make sure cable adapter is still flush with tape marker. If not, reposition cable adapter. Remove tape marker.

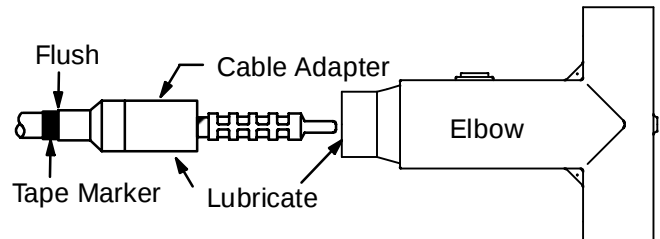

STEP 8 MATING PRODUCTS


DO NOT CONNECT OR DISCONNECT MATING PRODUCTS WHILE ENERGIZED.
DO NOT ENERGIZE WHILE DISCONNECTED.

Remove protective caps from the elbow and the mating part. Hand tighten the threaded stud supplied with the elbow into mating part, if the mating part is not equipped with a stud. Clean and lubricate both the elbow and the mating part with lubricant supplied. (Keep surfaces of elbow and mating part clean.)

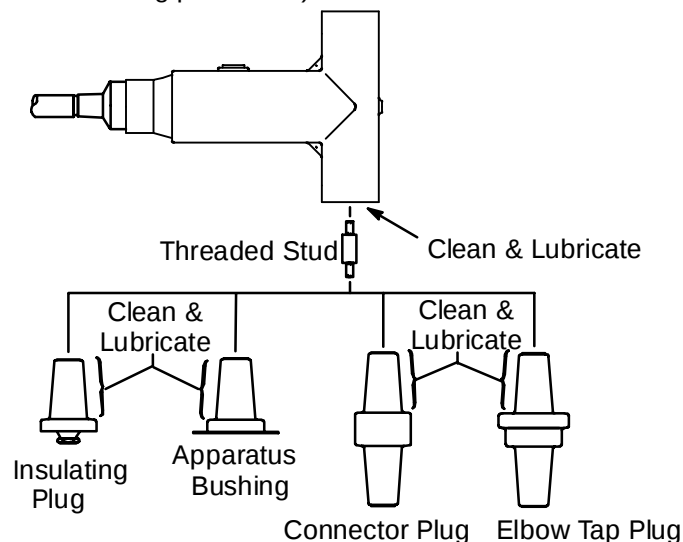


STEP 9

Push elbow onto mating part, lining up the hole in the compression lug with the stud on the mating part.

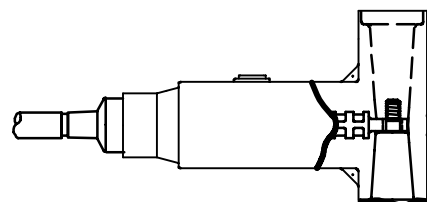


STEP 10

Clean and lubricate the mating part for the opposite end of the elbow. Insert the mating part into the elbow. Engage the threads and hand tighten. Torque mating part according to the instructions supplied with the mating part.

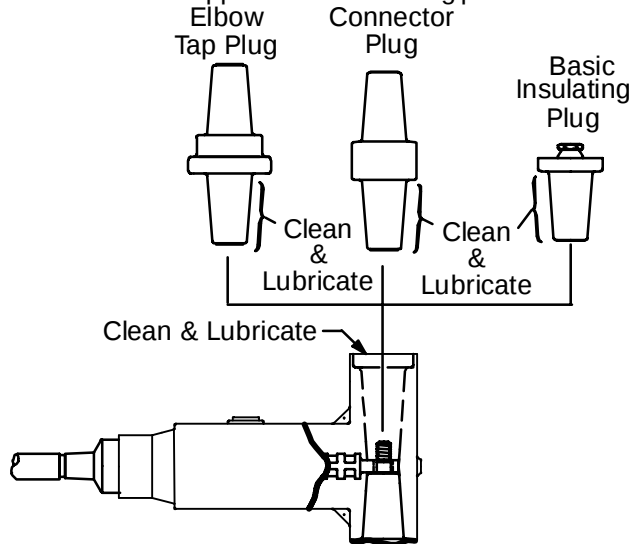

STEP 11

If an insulating plug is used as a mating part, clean and lubricate inner surface of the voltage detection cap and place on elbow. Push down hard until cap snaps into place.

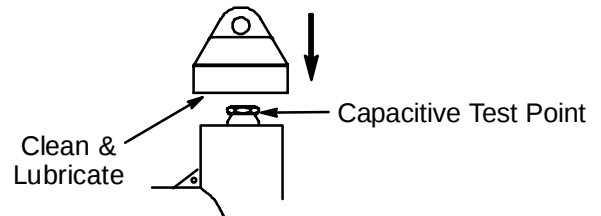


STEP 12

Insert one end of a piece of wire with ampacity at least equivalent to No. 14 AWG Copper through the grounding eye and twist to make a small loop. Do Not damage the eye. Connect wire to ground using a suitable connector.


The shield of the cable must be grounded. Ground according to the instructions supplied with the grounding device. If no grounding device is used, the shield must be grounded through an alternate method.

It is also recommended that the jacket of the cable be waterproofed at this point to prevent moisture from entering the cable.

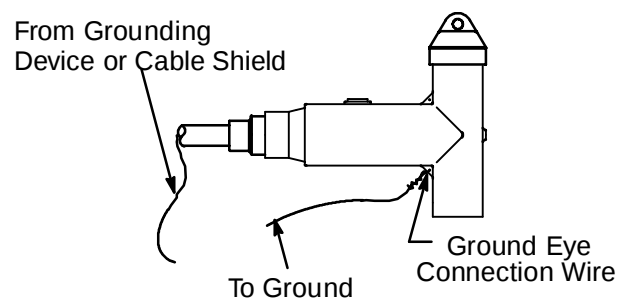

STEP 13

CAUTION: When constructing 600amp L-Kits be sure to tighten each component to specified torque per instructions provided with plug connectors.

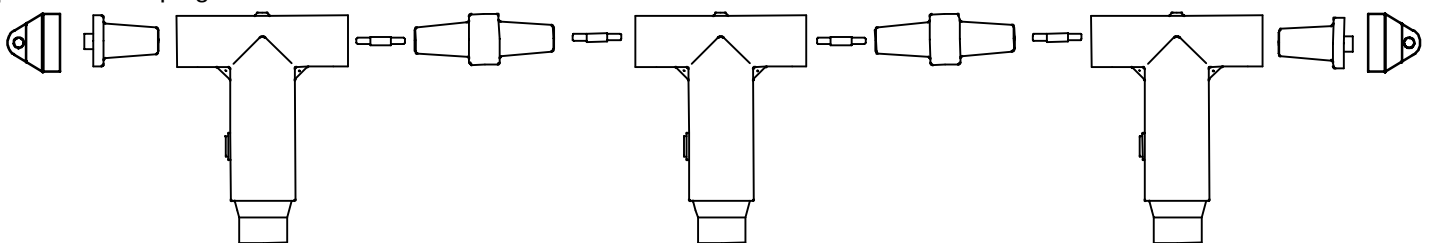

VOLTAGE TEST

The ELASTIMOLD[®] deadbreak elbow connector is equipped with an integral capacitance test point that can be used to establish whether or not the circuit is energized. When using the test point, complete the following steps:

1. Remove test point cap with a hotstick. When removing cap, **PEEL OFF AT AN ANGLE** rather than pulling directly in line with the test point assembly.
2. **WARNING:** THE VOLTAGE TEST POINT IS A CAPACITANCE DEVICE, IT IS NOT DIRECTLY CONNECTED TO THE CONDUCTOR. Do not use conventional voltage measuring equipment. Follow the manufacturer's directions for the meter that is used. Test with a suitable sensing device, made for use with separable connectors manufactured with capacitive test points, to determine if cable is energized. Contamination, moisture, dirt, etc. around the test point or use of the wrong measuring equipment can provide a false "no voltage" indication on an energized elbow. To prevent serious or fatal injury treat the elbow as energized until the "no voltage" test point indication is confirmed by other means.
3. After voltage detection has been made, clean and lubricate the inside surface of the cap with silicone lubricant and replace it on the test point.

THOMAS & BETTS CORP. PROPRIETARY AND CONFIDENTIAL

BY ACCEPTANCE OF THIS DOCUMENT YOU AGREE THAT ALL RIGHTS TO THE DRAWINGS AND INFORMATION CONTAINED IN IT, AS WELL AS THE SUBJECT MATTER AND ALL PROPRIETARY AND NOVEL FEATURES DISCLOSED, ARE OWNED BY THOMAS & BETTS CORPORATION ("THE COMPANY" AND A MEMBER OF THE ABB GROUP) AND THAT DEVICES EMBODYING SUCH FEATURES OR INFORMATION DERIVED FROM THESE DRAWINGS WILL NOT BE MANUFACTURED BY OR FOR YOU OR DISCLOSED TO OTHERS WITHOUT THE PRIOR EXPRESS WRITTEN CONSENT OF THE COMPANY. THESE DRAWINGS ARE NOT TO BE COPIED OR REPRODUCED OR DISCLOSED TO OTHERS WITHOUT THE PRIOR EXPRESS WRITTEN CONSENT OF THE COMPANY. ALL DRAWINGS AND INFORMATION ARE TO BE RETURNED TO UPON DEMAND OR UPON COMPLETION OF PURPOSE FOR WHICH LENT. COPYRIGHT THOMAS & BETTS CORP. ALL RIGHTS RESERVED. ALL OTHER TRADEMARKS ARE THE PROPERTY OF THEIR RESPECTIVE OWNERS.